

Use copper conductors only, 75°C or higher.
只能使用铜缆 75°C或更高

Flat 6,5
Pozidriv 2
十字螺丝刀2




0.35 in / 9 mm (M16 to/到 M40 - M CD63)
0.47 in / 12 mm (M63 to/到 M100 - M CD100)
Stripping distance. 绝缘剥离长度

M16 to M40 - M CD63


Wire / Câble / Cable / 电缆	Torque / Couple / Par de apriete / 扭矩
1,5 mm ² - 16 mm ² 14 - 4 AWG stranded 14 - 10 AWG solid 2x14 - 2x12 AWG stranded 2x12 AWG solid	26.5 lb.in / 3 Nm

M63 to/到 M100 - M CD100



Wire / Câble / Cable / 电缆	Torque / Couple / Par de apriete / 扭矩
2,5 mm ² - 35 mm ² 14 - 1 AWG stranded 14 - 10 AWG solid 2x10 - 2x6 AWG stranded 2x12 AWG solid	39.8 lb.in / 4.5 Nm

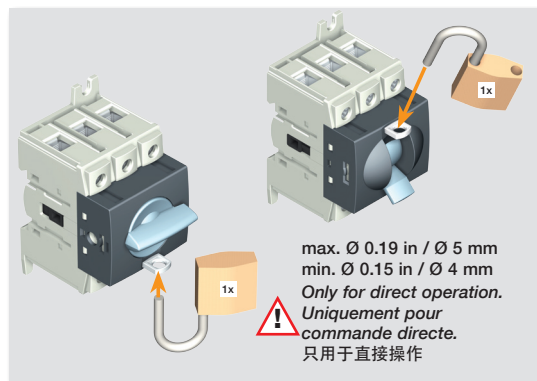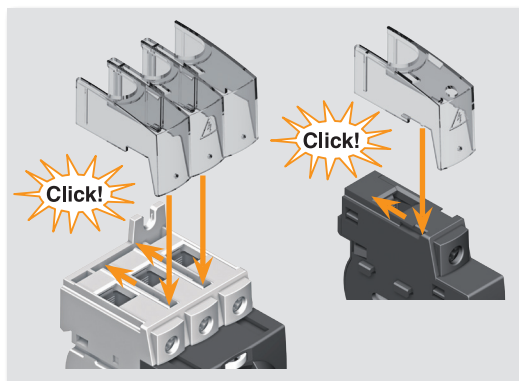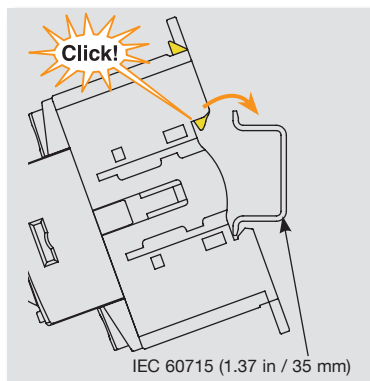


STEP 1 / 第1步

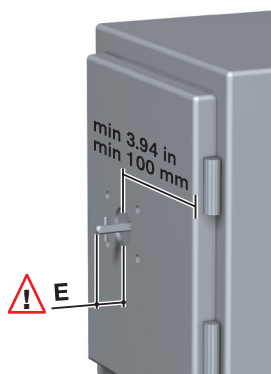

STEP 2 / 第2步

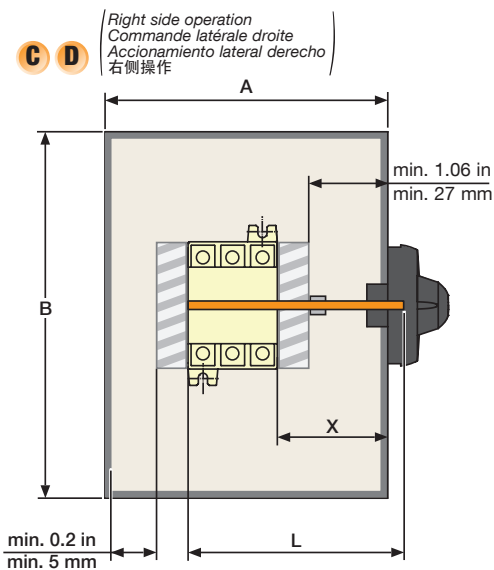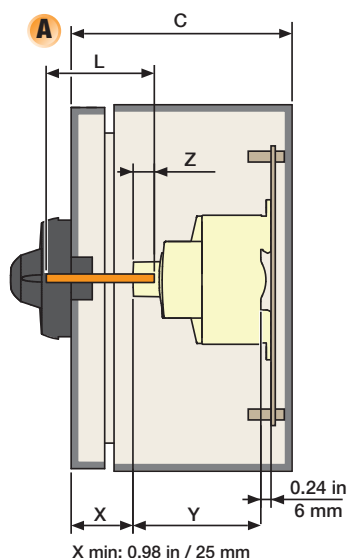


Switch / Interrupteur / Interruptor / 开关

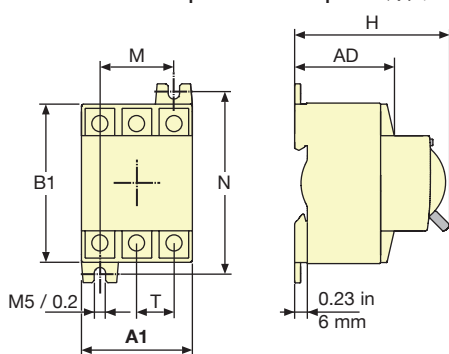

Add. Pole
Pôle additionnel
Polo adicional
附加极

Aux. Contacts
Contacts aux.
Contactos auxiliares
辅助触点

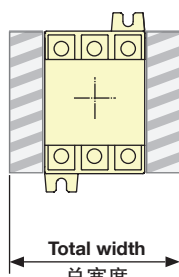

Total width = A1 + x A2 + y A3

if x = 0 y = 2 max
if x = 1 y = 2 max
if x = 2 y = 2 max

	A	C D	E	
	M16 to M40 - M CD63 M63 - M80 - M CD100	M16 to M40 - M CD63 M63 - M80 - M CD100	min.	max.
Type S000	L = X + 1.26 in L = X + 27 mm	L = X + 2.16 in L = X + 55 mm	L = X + 2.46 in L = X + 62.5 mm	0.31 in / 8 mm 0.39 in / 10 mm
Type S00	L = X + 1.26 in L = X + 32 mm	L = X + 2.36 in L = X + 60 mm	L = X + 2.66 in L = X + 67.5 mm	0.51 in / 13 mm 0.59 in / 15 mm
Type S01	L = X + 1.26 in L = X + 38.5 mm	L = X + 2.61 in L = X + 66.5 mm	L = X + 2.91 in L = X + 74 mm	0.68 in / 17.5 mm 0.84 in / 21.5 mm

Dual dimensions in/mm
Double dimensions in/mm
Doble dimensiones in/mm
双单位尺寸

	M16 to M40 - M CD63		M63 - M80 - M CD100	
	in	mm	in	mm
A	6	152	8	203
A1	1.77 (2.5 x 0.70)	45 (2.5 x 18)	2.06 (3 x 0.68)	52.5 (3 x 17.5)
A2	0.59	15	0.68	17.5
A3	0.34	8.8	0.34	8.8
AD	1.90	48.5	1.90	48.5
B	8	203	10	254
B1	2.67	68	3	76
C	4	102	4	102
H	2.95	75	2.95	75
T	0.59	15	0.68	17.5
N	2.95	75	3.35	85
M	1.18	30	1.38	35
Y	2.95	75	2.95	75
Z min.	0.47	12	0.47	12
Z max.	0.67	17	0.67	17